




Uranium in Water Intercomparison Study

A Statistical Evaluation of the November 13, 1992 Data



Uranium in Water
Intercomparison Study
November 13, 1992

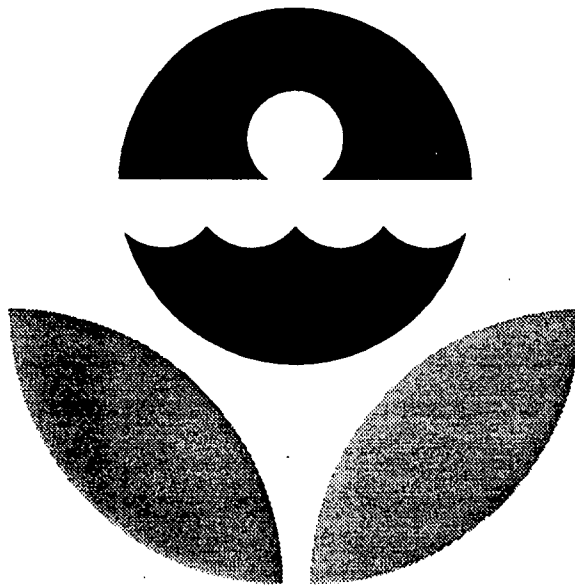

Environmental Protection Agency
Environmental Monitoring Systems Laboratory
Las Vegas, Nevada



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY
OFFICE OF RESEARCH AND DEVELOPMENT
ENVIRONMENTAL MONITORING SYSTEMS LABORATORY-LAS VEGAS
P.O. BOX 93478
LAS VEGAS, NEVADA 89193-3478
(702/798-2100)

Dear Participant,

Enclosed are the results of the Nuclear Radiation Assessment Division (EMSL-LV) Intercomparison Study for *Uranium in Water; November 13, 1992*.

The known value for each analysis was determined by gravimetric methods, checked by chemical analyses performed by EMSL-LV's Radiochemistry Laboratory, and compared to the participating laboratories' grand average.

The expected precision, determined by the known value, was taken from "Table 3. Laboratory Precision: One Standard Deviation Values and Control Limits for Various Analyses", which is based on data accumulated over the years by the Intercomparison Program, and can be found in the Environmental Radioactivity Laboratory Intercomparison Studies Program and Radioactive Standards Distribution Program information brochure.

Please take a few minutes to review this report and the analytical data your laboratory submitted to us. If there are any apparent discrepancies, please notify us immediately.

We encourage you to make use of the computer-automated data-entry system that has been in place for some time now. As the number of participants increases, and it becomes unrealistic for us to receive results by mail or FAX, the computer system will be our only avenue for accepting data.

If you have any questions or comments, please send a message via the data-entry system or contact Frank Novielli at 702/798-2159 or Patricia Honsa at 702/798-2141.

Sincerely,

A handwritten signature in cursive script, reading "Frank Novielli".

Frank Novielli
Senior Chemist
Radioanalysis Branch

Enclosure

NOTICE

**This material has been funded wholly by
the U.S. Environmental Protection Agency.
It has been subject to the Agency's review,
and has been approved for publication as
an EPA document.**

The following pages consist of separate sections for each of the nuclides in this study with four parts per section. After the first, each part is separated from the next by a new page or a thick horizontal bar. The first page of each section is a statistical summary for the nuclide and starts with a statement of the known value, the control limits, and the warning limits.

The warning limits are placed at two normalized standard deviations above and below the known value and the control limits are three normalized standard deviations above and below the known value. If you keep control charts, these values will be useful for anticipating problems with the accuracy of your analytical methods.

The coin shaped pie chart at the top of the summary page shows the fate of all the samples sent out in number and percentage terms. The pie chart starts at the top and rotates clockwise. The first sector represents those participants who submitted analytical results within both the warning and control limits. The next sector represents those who are in the warning region but not out of control. The third sector represents those who are out of control, but have passed the outlier test. The fourth sector represents those who have failed the outlier test. The last sector represents those participants who have failed to respond properly. This is the case if no analytical results were returned, or less than three determinations were reported, or if the results were received too late. The reeding on the edge of the coin is spaced at one percent intervals, and the sector shading becomes darker as the data reliability decreases. Sectors with zero width are not shown.

The table in the center shows a number of statistical quantities calculated from the submitted data based on the mean and median values in relation to the known value, both before and after outlier removal. The lower pie chart uses the same construction as the upper chart and shows the distribution of properly submitted data in terms of deviation from the known value divided into sectors representing one, two, three, and greater than three normalized standard deviations.

The second part is an alphabetical listing, in lab-code order, of submitted data and several calculated quantities. An entry that is shaded has been rejected because of one of the reasons listed above or failure of the outlier test. The fifth and sixth columns are a measure of laboratory precision. The Range analysis is a normalized value that you may use to keep precision control charts. If this value is between 2.0 and 3.0, your analytical process precision is in the warning zone; if it exceeds 3.0 it is out of control. The eighth and ninth columns are the differences from the mean of all non-outliers and from the known value, respectively. A tag symbol may appear in the last column. Each page with tags has a symbol definition summary at the bottom. If there is no tag symbol, the data is within the control limits, but it may be in the warning zone.

The third part is a three-column listing of result average, tag symbol, and lab-code in average order excluding those labs not responding properly. In this order, all outliers and out-of-control results appear at the top or bottom of the list.

The last part is two bar chart displays showing frequency distributions of responding participants. The first chart places the known value at the center and a bar at each 0.2 unit of expected precision. The second chart places the mean of the reported measurements at the center and a bar at each 0.2 unit of standard deviation. In both cases, a bar includes those results within 0.1 unit up to the maximum of six. Any results more than six units from the center value are shown cumulatively by a shaded bar one past the sixth unit. If the central tendency of the known value distribution falls away from the center, an error in accuracy is indicated. If the distribution is broad, poor precision is indicated. The mean value distribution is similar but uses the average and standard deviation of reported results as its basis.

The Range Analysis($R + SR$) is calculated from the range, mean range and standard error of the range values. The range is the difference between the maximum and minimum results for the laboratory. The mean range is calculated by multiplying the expected precision by 1.693(for three results). The standard error of the range is calculated by multiplying the mean range by 2.575(for three results), subtracting the mean range from this product, and dividing the result by 3. If the range is greater than the mean range, then the range analysis is calculated by subtracting the mean range from the range, dividing the result by the standard error of the range and adding 1. If the mean range is greater than or equal to the range, then the range analysis is calculated by dividing the range by the mean range.

The normalized deviation of the mean from the grand average is calculated from the deviation of the mean from the grand average and the standard error of the mean values. The deviation of the mean from the grand average is calculated by subtracting the grand average from the average of the laboratory's three results. The standard error of the mean is calculated by dividing the expected precision by the square root of 3(the number of results). The normalized deviation of the mean from the grand average is calculated by dividing the deviation of the mean from the grand average by the standard error of the mean.

The normalized deviation of the mean from the known value is calculated from the deviation of the mean from the known value and the standard error of the mean values. The deviation of the mean from the known value is calculated by subtracting the known value from the average of the laboratory's three results. The standard error of the mean is calculated by dividing the expected precision by the square root of 3(the number of results). The normalized deviation of the mean from the known value is calculated by dividing the deviation of the mean from the known value by the standard error of the mean.


A complete explanation of the statistical calculations involved in the report may be found in the Environmental Radioactivity Laboratory Intercomparison Studies Program information brochure [Draft Revision of EPA-600/4-81-004], available from Frank Novielli, EMSL-LV, 702/798-2159.

Uranium (Natural)


Statistical Summary

101 Participants

The known value of this nuclide is 15.2 pCi/l with an expected precision of 3.0; the control limits are 10.0 to 20.4; the warning regions are 10.0 to 11.7 and 18.7 to 20.4

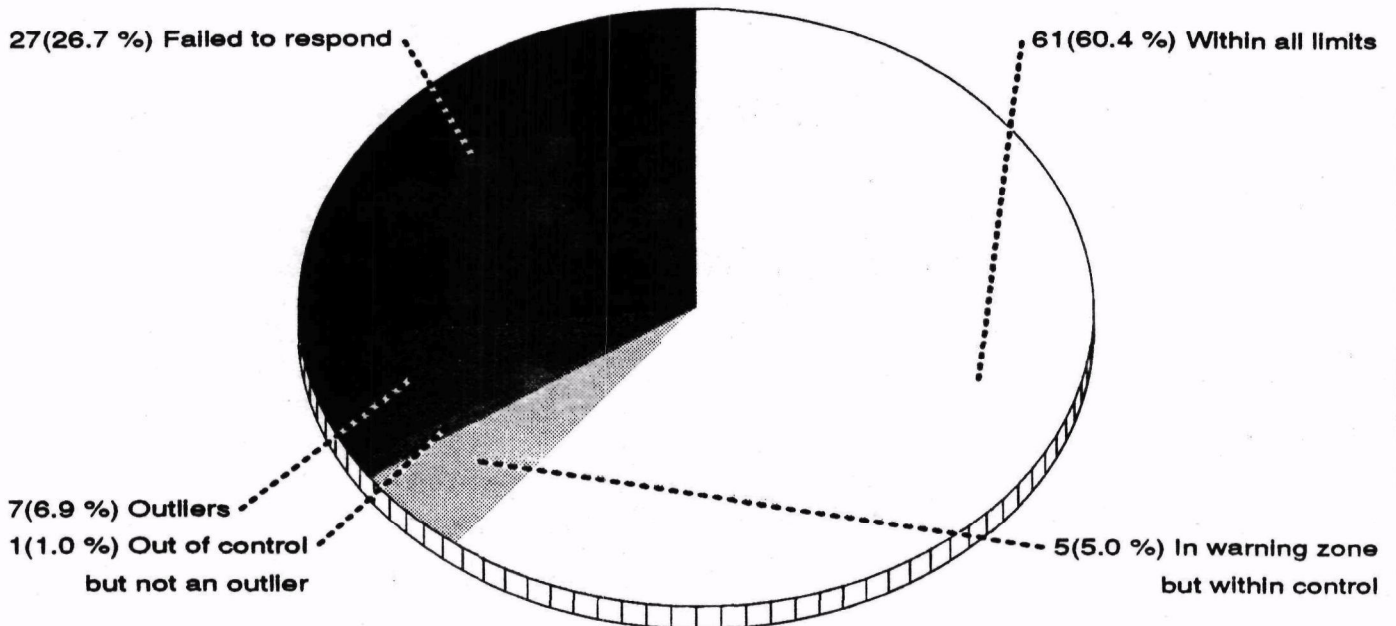

Statistic	Respondents	Non-outliers
Mean	15.40	Grand Avg 14.44
Std. Dev.	7.29	1.74
Variance	53.08	3.04
% Coef. of Var.	47.31	12.07
% deviation of mean from known value	1.31	-5.02
Norm. dev. of mean from known value	0.03	-0.44
Median	14.68	14.67
% deviation of median from known value	-3.40	-3.51
Norm. dev. of median from known value	-0.07	-0.31

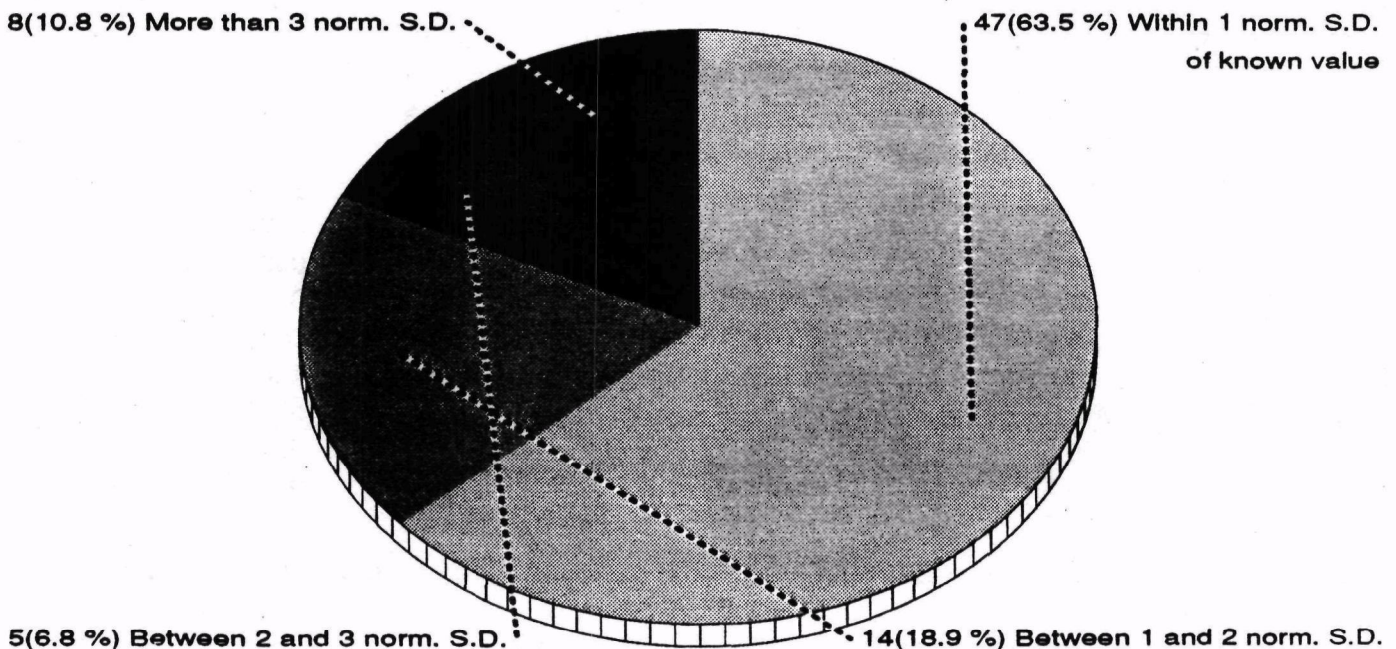

Uranium (Natural)

Lab	Res. 1	Res. 2	Res. 3	Exper. Sigma	Rng anal (R + SR)	Average	Normalized deviation (grand-avg) (known)		Tag
AA	15.7	15.1	15.5	0.31	0.118	15.43	0.58	0.13	
AF	14.7	17.4	15.8	1.36	0.532	15.97	0.88	0.44	
AK	17.4	14.9	15.6	1.29	0.492	15.97	0.88	0.44	
AL	13.4	13.0	12.8	0.31	0.118	13.07	-0.79	-1.23	
AW	7.6	7.5	7.4	0.10	0.039	7.50	-4.01	-4.45	×
BA	14.7	12.8	15.2	1.27	0.473	14.23	-0.12	-0.56	
BC	14.5	13.9	14.5	0.35	0.118	14.30	-0.08	-0.52	
BK	25.0	24.8	24.0	0.53	0.197	24.60	5.87	5.43	×
BL									•
BO	12.7	12.3	13.4	0.56	0.217	12.80	-0.95	-1.39	
C	13.2	13.3	12.8	0.26	0.098	13.10	-0.77	-1.21	
CA	15.3	15.0	16.1	0.57	0.217	15.47	0.59	0.15	
CE	15.1	14.2	14.8	0.46	0.177	14.70	0.15	-0.29	
CJ	15.0	15.0	16.0	0.58	0.197	15.33	0.52	0.08	
CK	14.6	14.4	15.1	0.36	0.138	14.70	0.15	-0.29	
D	14.7	14.7	14.8	0.06	0.020	14.73	0.17	-0.27	
DE	16.0	16.1	16.2	0.10	0.039	16.10	0.96	0.52	
DO									•
DT	4.8	6.4	10.1	2.72	1.083	7.10	-4.24	-4.68	×
DZ	17.1	16.8	17.3	0.25	0.098	17.07	1.52	1.08	
E	13.9	13.5	14.4	0.45	0.177	13.93	-0.29	-0.73	
EB	9.6	14.3	16.4	3.48	1.645	13.43	-0.58	-1.02	
ER	11.0	12.0	13.0	1.00	0.394	12.00	-1.41	-1.85	
FE	15.0	14.0	15.0	0.58	0.197	14.67	0.13	-0.31	
FN	15.0	16.0	16.0	0.58	0.197	15.67	0.71	0.27	
FZ	14.0	14.0	14.0	0.00	0.000	14.00	-0.25	-0.69	
GN	15.3	15.8	15.6	0.25	0.098	15.57	0.65	0.21	
GZ	14.0	13.1	15.5	1.21	0.473	14.20	-0.14	-0.58	
HK	16.2	14.6	14.6	0.92	0.315	15.13	0.40	-0.04	
HL	16.6	17.3	13.4	2.08	0.768	15.77	0.77	0.33	
HP	15.5	15.8	14.8	0.51	0.197	15.37	0.54	0.10	
HU									•
HY	14.0	13.3	12.6	0.70	0.276	13.30	-0.66	-1.10	
IE	13.0	13.7	13.3	0.35	0.138	13.33	-0.64	-1.08	
J	15.7	16.0	17.1	0.74	0.276	16.27	1.06	0.62	
JS	15.4	15.4	15.6	0.12	0.039	15.47	0.59	0.15	
JY	15.5	12.9	13.6	1.35	0.512	14.00	-0.25	-0.69	
K	14.3	16.4	17.6	1.67	0.650	16.10	0.96	0.52	
L	15.2	15.2	15.0	0.12	0.039	15.13	0.40	-0.04	
LH	11.0	11.0	11.0	0.00	0.000	11.00	-1.98	-2.42	
LM									•
LT	15.4	16.4	15.9	0.50	0.197	15.90	0.84	0.40	
LZ	15.6	15.7	16.0	0.21	0.079	15.77	0.77	0.33	
ME	14.1	14.5	15.0	0.45	0.177	14.53	0.06	-0.38	
MN									•

• = No data submitted

TAG SYMBOLS

↑ = Above control limit

∅ = Insufficient data

× = Determined to be an outlier

↓ = Below control limit

Uranium (Natural)								
Lab	Res. 1	Res. 2	Res. 3	Exper. Sigma	Rng anal (R + SR)	Average	Normalized deviation (grand-avg) (known) Tag	
MS	11.0	11.1	11.0	0.06	0.020	11.03	-1.97	-2.41
N								•
NA	15.0	16.0	17.0	1.00	0.394	16.00	0.90	0.46
NK	9.7	9.9	9.5	0.20	0.079	9.70	-2.74	-3.18
NO	13.8	14.2	14.7	0.45	0.177	14.23	-0.12	-0.56
NT	15.9	15.7	15.5	0.20	0.079	15.70	0.73	0.29
OA								•
OM								•
OS	9.6	10.3	10.3	0.40	0.138	10.07	-2.52	-2.96
OY	16.0	15.5	15.6	0.26	0.098	15.70	0.73	0.29
OZ	16.6	16.8	16.4	0.20	0.079	16.60	1.25	0.81
PB	15.8	15.5	15.2	0.30	0.118	15.50	0.61	0.17
PC								•
PE								•
PL								•
PP	15.3	15.1	16.0	0.47	0.177	15.47	0.59	0.15
PV	11.1	11.7	12.9	0.92	0.354	11.90	-1.46	-1.91
PW	69.0	68.9	71.6	1.53	0.532	69.83	31.98	31.54
PX	17.3	17.0	16.9	0.21	0.079	17.07	1.52	1.08
PY								•
QJ	12.8	12.7	12.7	0.06	0.020	12.73	-0.98	-1.42
QQ	11.1	10.2	10.6	0.45	0.177	10.63	-2.20	-2.64
QU								•
QZ	13.3	13.5	14.2	0.47	0.177	13.67	-0.44	-0.89
RC								•
RG								•
RK	39.7	29.8	21.3	6.34	3.746	28.27	7.98	7.54
RM	13.5	9.9	10.0	2.05	0.709	11.13	-1.91	-2.35
RN	11.9	13.3	12.9	0.72	0.276	12.70	-1.00	-1.44
RP	15.8	15.8	15.8	0.00	0.000	15.80	0.79	0.35
RR	14.6	14.7	14.5	0.10	0.039	14.60	0.09	-0.35
RV								•
RW	13.9	13.6	13.7	0.15	0.059	13.73	-0.41	-0.85
RZ	14.7	14.2	15.1	0.45	0.177	14.67	0.13	-0.31
S	13.5	13.4	15.9	1.42	0.492	14.27	-0.10	-0.54
SC								•
SD	12.7	12.9	12.9	0.12	0.039	12.83	-0.93	-1.37
SL								•
SO	14.5	14.4	14.4	0.06	0.020	14.43	0.00	-0.44
SS	14.4	14.5	14.2	0.15	0.059	14.37	-0.04	-0.48
ST								•
SZ	16.4	15.0	14.5	0.98	0.374	15.30	0.50	0.06
TA								•
TD								•
TE	31.0	26.7	28.9	2.15	0.847	28.87	8.33	7.89

• = No data submitted

TAG SYMBOLS

↑ = Above control limit

∅ = Insufficient data

× = Determined to be an outlier

↓ = Below control limit

Uranium (Natural)

Lab	Res. 1	Res. 2	Res. 3	Exper. Sigma	Rng anal (R + SR)	Average	Normalized deviation (grand-avg) (known)		Tag
TG	5.7	5.7	6.9	0.69	0.236	6.10	-4.81	-5.25	×
TI	14.4	13.4	14.9	0.76	0.295	14.23	-0.12	-0.56	
TJ									•
TK									•
TL	17.4	16.2	15.8	0.83	0.315	16.47	1.17	0.73	
TP	14.9	14.7	14.9	0.12	0.039	14.83	0.23	-0.21	
TU	18.0	18.6	18.7	0.38	0.138	18.43	2.31	1.87	
TW									•
TZ									•
U									•
UB									•

Data sorted by Laboratory Average

Average	Tag	Lab	Average	Tag	Lab	Average	Tag	Lab
6.10	×	TG	14.00		FZ	15.47		CA
7.10	×	DT	14.20		GZ	15.50		PB
7.50	×	AW	14.23		TI	15.57		GN
9.70	↓	NK	14.23		NO	15.67		FN
10.07		OS	14.23		BA	15.70		NT
10.63		QQ	14.27		S	15.70		OY
11.00		LH	14.30		BC	15.77		LZ
11.03		MS	14.37		SS	15.77		HL
11.13		RM	14.43		SO	15.80		RP
11.90		PV	14.53		ME	15.90		LT
12.00		ER	14.60		RR	15.97		AK
12.70		RN	14.67		RZ	15.97		AF
12.73		QJ	14.67		FE	16.00		NA
12.80		BO	14.70		CK	16.10		K
12.83		SD	14.70		CE	16.10		DE
13.07		AL	14.73		D	16.27		J
13.10		C	14.83		TP	16.47		TL
13.30		HY	15.13		L	16.60		OZ
13.33		IE	15.13		HK	17.07		PX
13.43		EB	15.30		SZ	17.07		DZ
13.67		QZ	15.33		CJ	18.43		TU
13.73		RW	15.37		HP	24.60	×	BK
13.93		E	15.43		AA	28.27	×	RK
14.00		JY	15.47		PP	28.87	×	TE
			15.47		JS	69.83	×	PW

• = No data submitted

TAG SYMBOLS

↑ = Above control limit

∅ = Insufficient data

× = Determined to be an outlier

↓ = Below control limit

Uranium (Natural)

